Error Code 200

Manual Version 1.0 | Revised 03/13/23

Troubleshooting steps

1 Check that the daisy chain position on the FuelCloud website matches the indicator on the CloudBox.

If the CloudLink does not have an indicator the daisy chain position is "0".

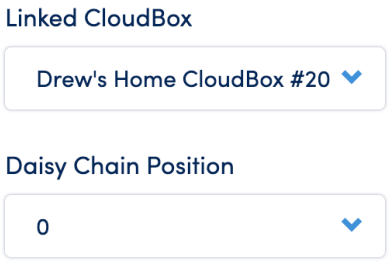

2 Check that the D9 power LED on the CloudBox is illuminated.

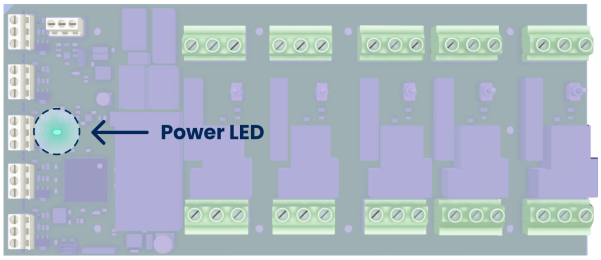

3 Check that the AC/DC switch is set to the correct power type.

4 Check that there is the correct voltage on Pump Control 1.

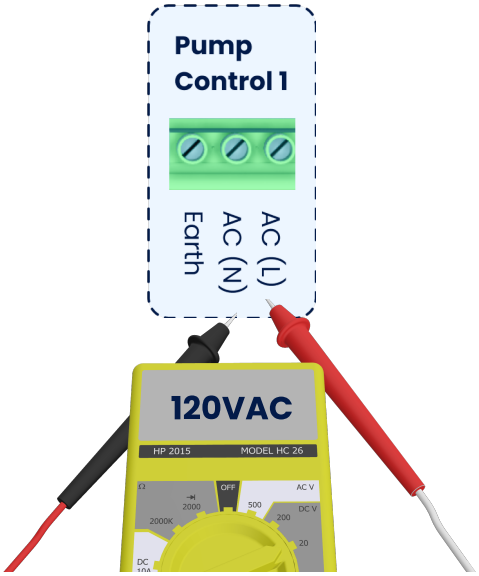

5 Check that the fuse next to the AC/DC switch is not blown.

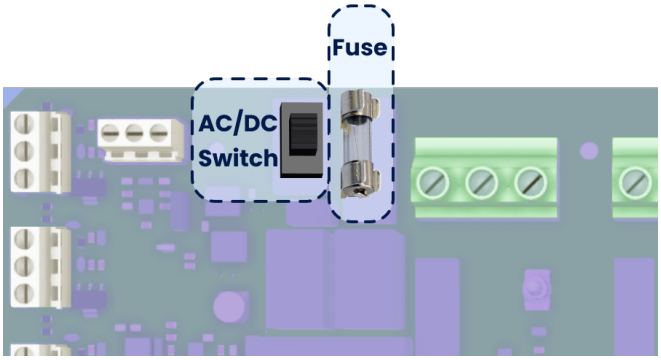

Note: The fuse is a 5mm x 20mm 1 amp 250V fast blow fuse.

6 Check that the wiring between the CloudBox and CloudLink matches A to A, B to B, and GND to GND.

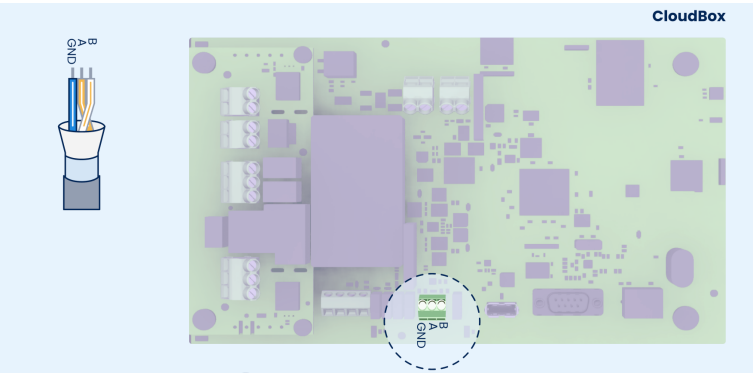

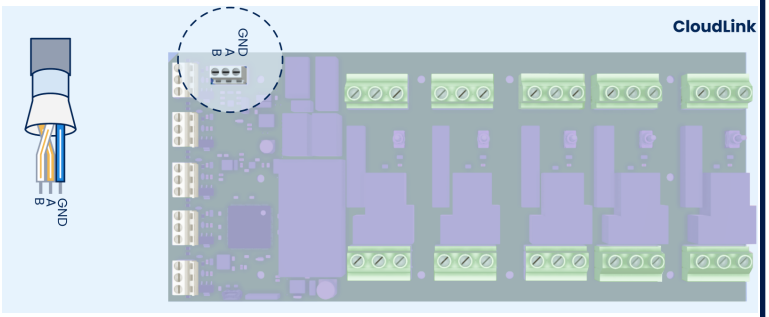

7 Check that the RS485 wire is the correct twisted pair + 1 and shield. FuelCloud recommends the Belden 8772:

Belden 8772

8 If all of these are true, please contact FuelCloud support.

844-792-6071

support@fuelcloud.com